


ARMATURA: WYMIARY PRZYŁĄCZENIOWE KOŁNIERZY

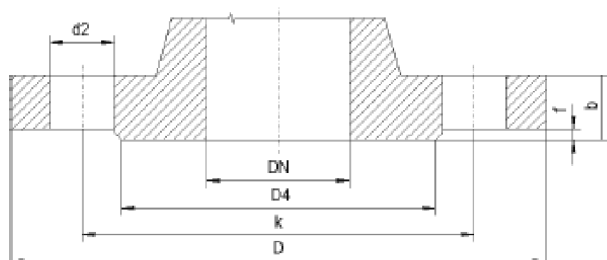

PN	WYMIAR		DN													
			10	15	20	25	32	40	50	65	80	100	125	150	200	
10	kołnierz	D	90	95	105	115	140	150	165	185	200	220	250	285	340	
		b	14	14	16	16	16	16	18	18	20	20	22	22	24	
		k	60	65	75	85	100	110	125	145	160	180	210	240	295	
	przyłga	D4	40	45	58	68	78	88	102	122	138	158	188	212	268	
		f	2	2	2	2	2	3	3	3	3	3	3	3	3	
	śruby	L.otw.	4	4	4	4	4	4	4	4	4	8	8	8	8	8
		Gwint	M12	M12	M12	M12	M12	M12	M12	M12	M12	M12	M12	M12	M12	M12
		d2	14	14	14	14	18	18	18	18	18	18	18	22	22	
	16	kołnierz	D	90	95	105	115	140	150	165	185	200	220	250	285	340
b			14	14	16	16	16	16	18	18	20	20	22	22	24	
k			60	65	75	85	100	110	125	145	160	180	210	240	295	
przyłga		D4	40	45	58	68	78	88	102	122	138	158	188	212	268	
		f	2	2	2	2	2	3	3	3	3	3	3	3	3	
śruby		L.otw.	4	4	4	4	4	4	4	4	4	8	8	8	8	12
		Gwint	M12	M12	M12	M12	M16	M16	M16	M16	M16	M16	M16	M20	M20	
		d2	14	14	14	14	18	18	18	18	18	18	18	22	22	
25		kołnierz	D	90	95	105	115	140	150	165	185	200	235	270	300	360
	b		16	16	18	18	18	18	20	22	24	24	26	28	30	
	k		60	65	75	85	100	110	125	145	160	190	220	250	310	
	przyłga	D4	40	45	58	68	78	88	102	122	138	162	188	218	278	
		f	2	2	2	2	2	3	3	3	3	3	3	3	3	
	śruby	L.otw.	4	4	4	4	4	4	4	8	8	8	8	8	12	
		Gwint	M12	M12	M12	M12	M16	M16	M16	M16	M16	M20	M24	M24	M24	
		d2	14	14	14	14	18	18	18	18	18	22	26	26	26	
	40	kołnierz	D	90	95	105	115	140	150	165	185	200	235	270	300	375
b			16	16	18	18	18	18	20	22	24	24	26	28	34	
k			60	65	75	85	100	110	125	145	160	190	220	250	320	
przyłga		D4	40	45	58	68	78	88	102	122	138	162	188	218	285	
		f	2	2	2	2	2	3	3	3	3	3	3	3	3	
śruby		L.otw.	4	4	4	4	4	4	4	8	8	8	8	8	12	
		Gwint	M12	M12	M12	M12	M16	M16	M16	M16	M16	M20	M24	M24	M27	
		d2	14	14	14	14	14	18	18	18	18	22	26	26	30	
63		kołnierz	D	100	105	130	140	155	170	180	205	215	250	295	345	415
	b		20	20	22	24	24	26	26	26	28	30	34	36	42	
	k		70	75	90	100	110	125	135	160	170	200	240	280	345	
	przyłga	D4	40	45	60	68	78	88	102	122	138	162	188	218	285	
		f	2	2	2	2	2	3	3	3	3	3	3	3	3	
	śruby	L.otw.	4	4	4	4	4	4	4	8	8	8	8	8	12	
		Gwint	M12	M12	M16	M16	M20	M20	M20	M20	M20	M24	M27	M30	M33	
		d2	14	14	18	18	22	22	22	22	22	26	30	33	36	
	100	kołnierz	D	100	105	130	140	155	170	195	220	230	265	315	355	430
b			20	20	22	24	24	26	28	30	32	36	40	44	52	
k			70	75	90	100	110	125	145	170	180	210	250	290	360	
przyłga		D4	40	45	60	68	78	88	102	122	138	162	188	218	285	
		f	2	2	2	2	2	3	3	3	3	3	3	3	3	
śruby		L.otw.	4	4	4	4	4	4	4	8	8	8	8	12	12	
		Gwint	M12	M12	M16	M16	M20	M20	M24	M24	M24	M27	M30	M30	M33	
		d2	14	14	18	18	22	22	26	26	26	30	33	33	36	
160		kołnierz	D	100	105	130	140	155	170	195	220	230	265	315	355	430
	b		20	20	22	24	24	28	30	34	36	40	44	50	60	
	k		70	75	90	100	110	125	145	170	180	210	250	290	360	
	przyłga	D4	40	45	60	68	78	88	102	122	138	162	188	218	285	
		f	2	2	2	2	2	3	3	3	3	3	3	3	3	
	śruby	L.otw.	4	4	4	4	4	4	4	8	8	8	8	12	12	
		Gwint	M12	M12	M16	M16	M20	M20	M24	M24	M24	M27	M30	M30	M33	
		d2	14	14	18	18	22	22	26	26	26	30	33	33	36	